PAD6 PADAIR2 Blurred screen Repair

Model: Apple Ipad air 2

Symptom: boot Blurred screen restart

Maintenance after:

Looking at a few pictures to see a few pictures feels a bit useful for everyone to write an article.The PAD6 boot Blurred screen will also restart the system.As shown

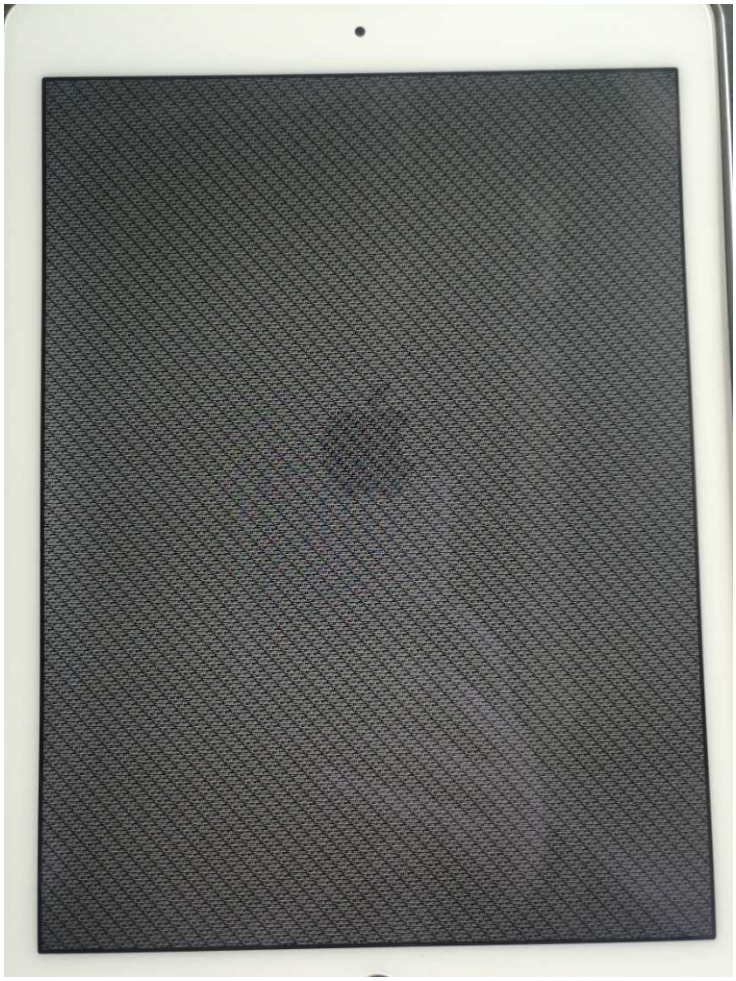



Recovery reported error 4013 feeling that the flash problem is big.

Disassemble the NAND and found it.First remove the NAND, brush it and report the same mistake.

Directly flash memory.

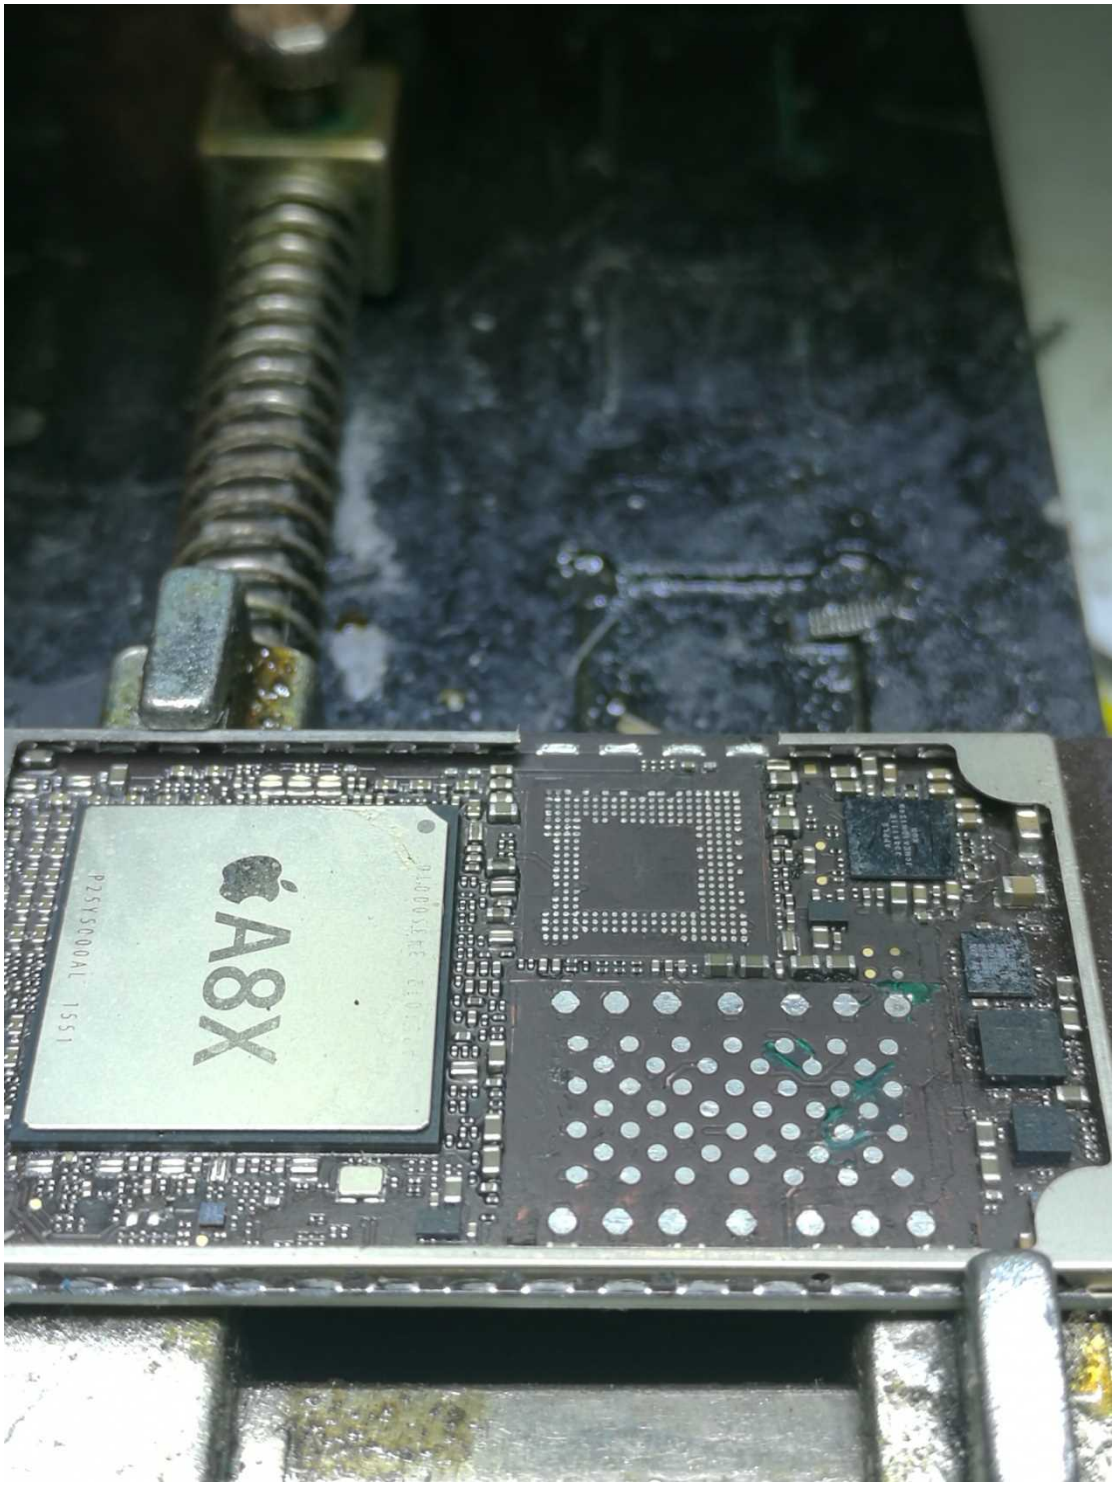

The flash memory is installed, then Recovery.Ok.Recovery reports an invalid serial number.

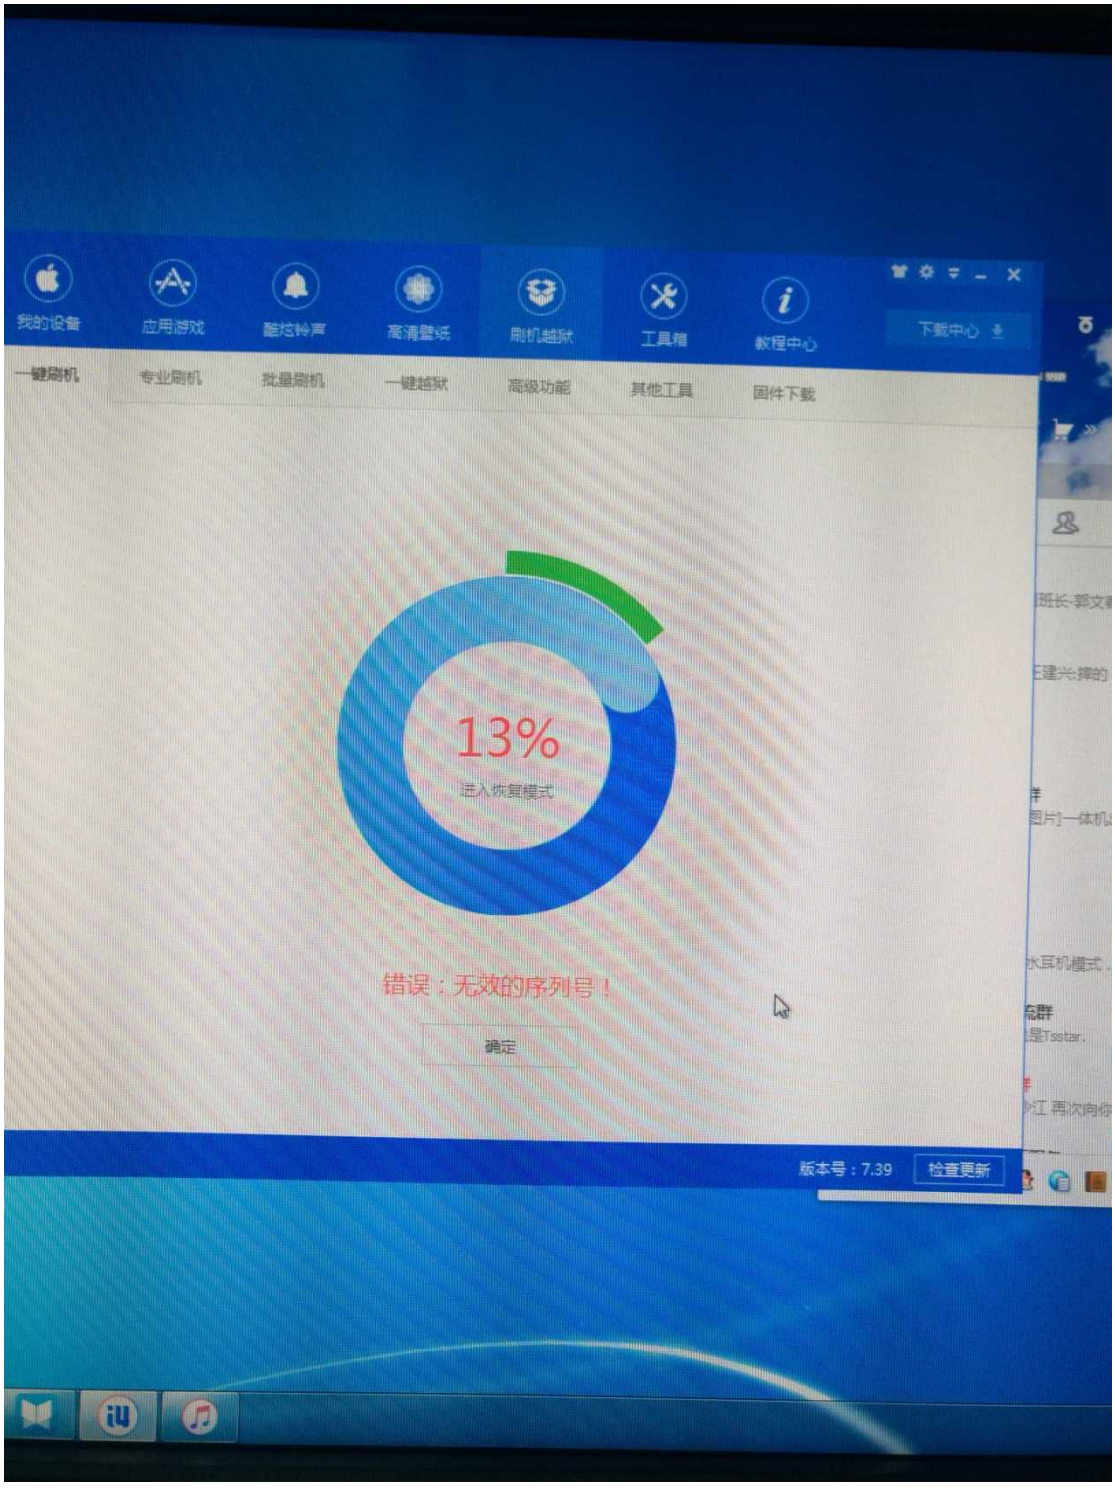

Brushing to the invalid serial number is basically no problem with flash.Install the NAND directly.

Since I didn't want to write it at the time, there were not many photos.Just let everyone know that this Blurred screen reboot is a flash issue.

Everyone can do flash memory directly.The NAND was moved, and it was estimated that the flash memory was blown by the Void welding.In the previous expansion of

the machine, the customer said that it took a long time to go wrong.Therefore, PAD6 everyone should pay attention to it.It is so close to the CPU flash.When I saw the picture, I expanded it from the inside.I usually cut the Shielding cover from the outside and smashed it from the outside. I feel safer than from inside.Give a picture to everyone to refer to



This machine is now repaired.

Author Chen Xiang

WeChat: 15061138329